


INSTALLATION INSTRUCTIONS CORD CONNECTORS

FOR INDOOR - OUTDOOR USE

COMPRESSION NUT
(nylon shown)

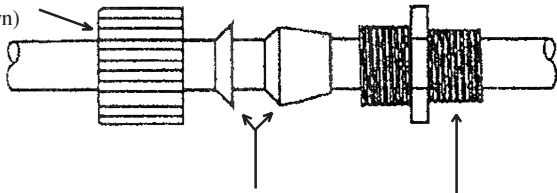

1. APPLY COMPRESSION NUT OVER CORD

2. SLIP ON RING AND BUSHING

3. POSITION BODY ON CORD THEN SLIDE PRECEDING COMPONENTS TO BODY FOR ASSEMBLY.

4. TIGHTEN TO ASSURE A LIQUID TIGHT SEAL. HAND TIGHTEN FOR NYLON, WRENCH TIGHTEN FOR METAL.

5. STRIP CORD JACKET AS DESIRED.

6. SECURE WITH LOCKNUT.

WHEN CORD DIAMETER IS TOO LARGE TO PASS THROUGH THE BODY, STRIP OFF CORD JACKET TO END OF RUBBER BUSHING MAKE SURE THAT JACKET IS COMPLETELY COVERED BY BUSHING WHEN ASSEMBLED.

**Wiring Device-Kellems
Hubbell Incorporated (Delaware)
185 Plains Road
Milford, CT 06460-8897
(203) 882-4800**



Gotcha®ring Color Guide

Cord Diameter (inches)	Color
.062 - .125	Green
.125 - .187	Orange
.187 - .250	Red
.250 - .375	White
.375 - .500	Blue
.500 - .625	Brown
.625 - .750	Yellow
.750 - .875	Purple

Portable Cord Chart and Matching Gotcha®ring Colors

	SV, SVO, SVT	SJ, SJO SJT, SJTO			S, SO ST, STO				
	#18	#18	#16	#14	#18	#16	#14	#12	#10
2 Conductor inches millimeters	Black .250 6.22	Black .305 7.75	White .330 8.38	White .365 9.27	Blue .380 9.65	Blue .400 10.2	Brown .540 13.7	Brown .615 15.6	Yellow .675 17.1
3 Conductor inches millimeters	Black .255 6.48	White .325 8.26	White .350 8.89	Blue .385 9.78	Blue .390 9.91	Blue .420 10.7	Brown .565 14.4	Brown .645 16.4	Yellow .710 18.0
4 Conductor inches millimeters		White .355 9.02	Blue .425 10.8	Blue .425 10.8	Blue .420 10.7	Blue .450 11.4	Brown .610 15.5	Yellow .700 17.8	Purple .765 19.4
5 Conductor inches millimeters					Blue .500 12.7	Brown .540 13.7	Yellow .695 17.7	Purple .760 19.3	Purple .830 21.1